

DATE 1620Z 26 FEB 65

SECRET

1	INTEL	9
2	DFA	10
3	CC	11
4	IDEA	12
5	OAD	13
6	STCH	14
7	RB	15
8		16

ROUTINE

IN73964

TO DIRECTOR

FROM

ACTION:

INFO :

TOR: 1710Z 26 FEB 65

OSA/1-15

TO

PRIORITY

INFO

CITE

25X1

25X1A

A. C055C

B. FOLLOWING IS QUALITY EVALUATION REPORT OF FIELD PROCESSED MISSION C055C WHICH WAS DONE ON MODEL 3 MACHINE.

1. GENERAL APPEARANCE OF THE ORIGINAL NEGATIVE IS GOOD TO EXCELLENT.

2. REWASHING WAS NOT NECESSARY. TESTS AT [] INDICATED ARCHIVAL QUALITY.

25X1A

3. SCISSOR CUT, MADE AT FOLLOWING FRAMES, WANDERED INTO FORMAT AREA FROM 1/8 TO 1/4 INCH.

9R 0256-0257 - TITLE NDRS.

9L 0265-0266 - " "

4. EXAMPLES OF EMULSION SCRATCHES ON FOLLOWING FRAMES WERE PROBABLY CAUSED BY RESTART ON PROC. MACH. TAKE UP SPOOL AFTER MACHINE CUT.

9R - 0257

9L - 0266 & 0267

S E C R E T

25X1A

[REDACTED]

PAGE TWO

5. EXAMPLES OF HANDLING MARKS AT MACHINE CUTS.

9R - 0256

9L - 0265

6. HANDLING TROUBLES MENTIONED IN PARAS 3, 4 AND 5 COULD BE ELIMINATED BY INSTALLATION OF ADDITIONAL EQUIPMENT AT MODEL 3 MACHINE TAKE OFF. AUTHORITY TO PROVIDE WAS REQUESTED BY [REDACTED] FROM

25X1A

25X1A

[REDACTED] ON 17 DECEMBER.

7. 9L, FRAME 0538 SHOWS 3 SPOTS WHICH ARE PINK IN COLOR EACH ABOUT 1/16 INCH IN DIAMETER. CAUSE UNKNOWN.

8. 9L, FRAMES 0163 & 0164 TITLE SMEARED DUE TO ERASURE AND RE-TITLING. NUMEROUS INSTANCES ON BOTH 9L AND 9R OF BLOCKED IN TITLING WITHIN LOOP OF G'S, 9'S AND R'S. TITLING DONE AT [REDACTED]

25X1A

9. 9R, FRAME 0396, MYLAR TAPE REPAIR MADE. FILM TORN 1 INCH FROM CLOCK EDGE WHILE CHANGING IDENT. THIS DAMAGE DONE AT [REDACTED]

25X1A

10. PROCESSING STREAKS ON 9L, MENTIONED IN [REDACTED] FROM

25X1A

25X1A

[REDACTED] NOT NOTICABLE ON 5 PARTS SENT TO [REDACTED]

25X1A

END OF MESSAGE

S E C R E T